




**VACONSA**

## Tabla de Medidas

### Conexión Forjada Caja para Soldar (SW)

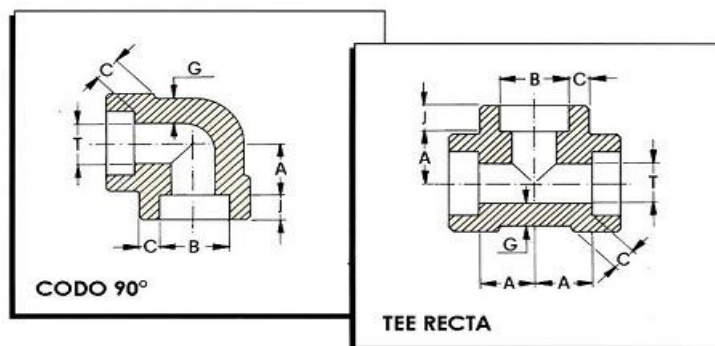

CLASE	PULG	1/8	1/4	3/8	1/2	DIAMETRO NOMINAL							
						3/4	1	1 1-4	1 1-2	2	2 1-2	3	4
3000 LBS	A MAX	11.9	11.9	15.0	17.2	20.5	24.4	28.9	33.8	40.1	43.7	59.7	69.1
	MIN	10.4	10.4	12.0	14.2	17.5	20.3	24.9	29.7	36.1	38.6	54.6	64.0
	C PROM	3.2	3.8	4.0	4.7	4.9	5.7	6.1	6.4	6.9	8.8	9.5	10.7
	MIN	3.2	3.3	3.5	4.1	4.3	5.0	5.3	5.5	6.0	7.7	8.3	9.3
	G MIN	2.4	3.0	3.2	3.7	3.9	4.5	4.9	5.1	5.5	7.0	7.6	8.6
	T MAX	7.6	10.0	13.3	16.6	21.7	27.4	35.8	41.6	53.3	64.2	79.5	103.8
	MIN	6.1	8.5	11.8	15.0	20.2	25.9	34.3	40.1	51.7	61.2	76.4	100.7
6000 LBS	A MAX	11.9	15.0	17.2	20.5	24.4	28.9	33.8	40.1	43.6	59.6	67.0	82.2
	MIN	10.4	12.0	14.2	17.5	20.3	24.9	29.7	36.1	38.6	54.6	61.0	76.2
	C PROM	4.0	4.6	5.0	6.0	7.0	7.9	7.9	8.9	10.9	11.9	13.9	16.9
	MIN	3.4	4.0	4.4	5.2	6.0	6.9	6.9	7.8	9.5	10.4	12.2	14.8
	G MIN	3.1	3.7	4.0	4.8	5.6	6.3	6.3	7.1	8.7	9.6	11.2	13.6
	T MAX	4.8	7.1	9.9	12.5	16.3	21.5	30.2	34.7	43.6	54.8	66.3	88.0
	MIN	3.2	5.6	8.4	11.0	14.8	19.9	28.7	33.2	42.1	53.3	64.8	86.5
CAJA	B MAX	10.9	14.3	17.8	22.0	27.3	34.1	42.8	48.9	61.4	74.2	90.2	115.8
	MIN	10.7	14.1	17.5	21.7	27.0	33.8	42.5	48.6	61.1	73.8	89.8	115.4
	J MIN	9.7	9.7	9.7	9.7	12.7	12.7	12.7	12.7	15.7	15.7	15.7	19

*Nota: todas las dimensiones son en milímetros y pueden variar dependiendo del fabricante.*